


## MAGNETIC PARTICLE INSPECTION REPORT

Date of Thorough Examination: 28/12/2022	Report number: A/50805/22/12/39	Job no: 50805
Name and Address of the Owner of the Equipment:  TRUCK OMAN EQUIPMENT RENTAL SULTANATE OF OMAN		Address of premises at which the examination was made:  FARAH
Method: WET Surface Condition: Acceptable	Material: Carbon Steel Equipment: Permanent magnet Yoke	Test temperature: Ambient
Area Inspected ( tick the appropriate box):  <input type="checkbox"/> Weldment areas <input type="checkbox"/> Stress Areas <input type="checkbox"/> Full Body <input checked="" type="checkbox"/> Others [TOP SURFACE]		
WHITE CONTRAST PAINT: Magnavis WCP	MAGNETISING METHOD: Wet suspension black ink	
BLACK MAGNETIC INK: Magnaflux 7HF	ACCEPTANCE CODE: ASME V ARTICLE 7 , ASTM E709 ,AWS D1.1	
Description and identification of the equipment:  <u>FIFTH WHEEL</u>		
Make: JOST		
Model No.: JSK 38 C		
Reg. No.: 7159 DS		
Owner ID No.: PLM 1023		
Qty: 1no		
Date of Last MPI/ Cert No (If any): New		
Result of the above test:  MPI TEST CARRIED OUT SATISFACTORILY, FOUND NO RELEVANT INDICATIONS AT THE TIME OF INSPECTION		
Inspected by, Name & Signature: Koshy Mathew		Latest date by which next MPI must be carried out:  After One Year As Per Client Requirement Or At The Discretion Of Lifting Inspector
Qualification: ASNT L2		
Name and address of employer of persons making and authenticating this report:  Address: SAFETY TECHNICAL SERVICES AND INSPECTIONS P.O. Box 3288. Airport Heights PC 111 Sultanate of Oman. <a href="mailto:lifting@safetyoman.com">lifting@safetyoman.com</a>		

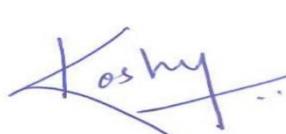