


MAGNETIC PARTICLE EXAMINATION REPORT

Date of Examination: 11/05/2023		Report No: HITECH/TJN-2022-229/MT-053	
Client: M/S.TRUCKOMAN EQUIPMENT RENTAL. LLC		Contractor: N/A	
Project: N/A		Location: TRUCKOMAN WORKSHOP-ADAM, SULTANATE OF OMAN	
Procedure No. & Rev. No.: HITIS/GEN/MT/01 REV.02		Referencing Code / Specification: ASTM E709	
Acceptance Criteria: AWS D1.1 ED 2015		Material: CS	
Surface Condition: Acceptable		Surface Temperature: Ambient	
PWHT: N/A			
Method: ☒ Wet ☒ Visible ☐ Dry ☐ Fluorescent		Technique: ☒ Continuous ☐ Residual	
Magnetization: ☒ Longitudinal ☐ Circular			
Equipment Type: Permanent Magnetic Yoke		Equipment Sr. No: GAMMATEC 00810	
Cal. Validity: Prior to Job			
Type of Current: N/A		Lifting Power of Yoke: 18.1 KG	
Sensitivity: ☒ Burnah Strip ☐ Pie Gauge III Lines Visible		Light Intensity: ≥ 1000 lux min	
Source of Light: Day light			
Consumables: MAGNAFLUX			
Cleaner : MAGNAFLUX SKC-S		White contrast : MAGNAFLUX WCP-2	
Batch No: 220513		Batch No: 220506	
Validity: MAY-2025		Validity: MAY-2025	
Magnetic Ink : MAGNAFLUX 7 HF		Batch No: 220508	
Validity: MAY-2025			
Item Description/Line No./ Drawing No.	Weld No	Welder No	Size
		Sch. / WT	Observation (Map or Record of Indication)
			Result (Acc./Rej.)

REGISTRATION NO & OWNER ID NO:- 2213YB / TER1008

<u>FIFTH WHEEL</u> MAKE: JOST TYPE: JSK 38C1 SERIAL NO: 16547913-63	N/A	N/A	N/A	N/A	NO RELEVANT INDICATION OBSERVED	ACCEPTED
--	-----	-----	-----	-----	---------------------------------	----------

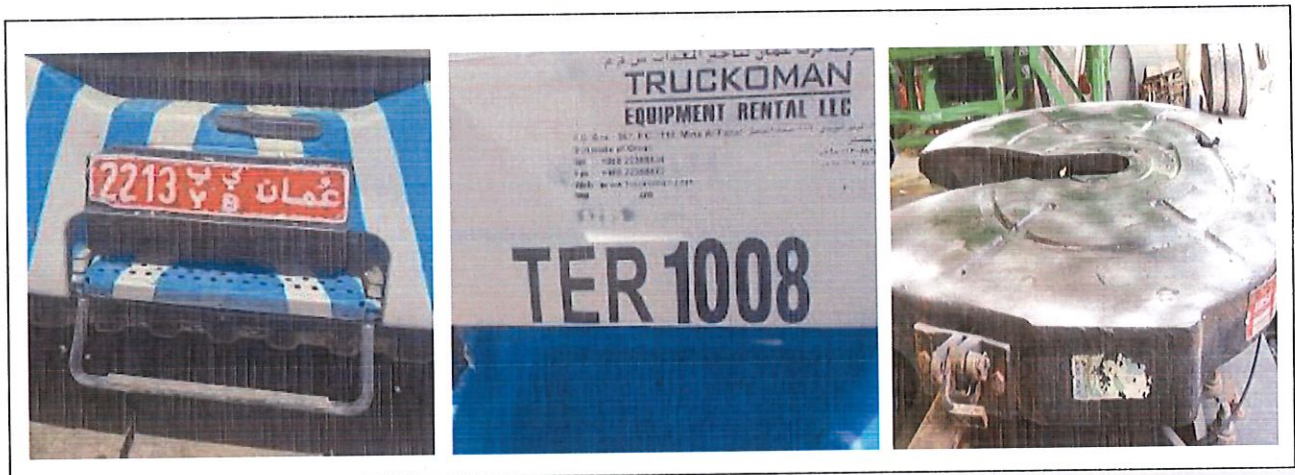

"MPI TEST CARRIED OUT SATISFACTORILY, FOUND NO RELEVANT INDICATIONS AT THE TIME OF INSPECTION"

LATEST DATE BY WHICH NEXT MPI MUST BE CARRIED OUT:

10/05/2024

Hi-Tech Inspection Services LLC	Contractor	Client/ TPI /AI
Signature:	Signature:	Signature:
Name: LAKSHMANDAS.M	Name:	Name:
Qualification: MPT Level II	Date:	Date:
Date: 11/05/2023		