



CERTIFICATE OF THOROUGH EXAMINATION AND TEST OF FORKLIFT

Certificate No: O/40328/19/05/01

Date of Inspection: 05/05/2019

Name and Address of the Owner:	TRUCK OMAN EQUIPMENT RENTAL
Maker & Date of Manufacture:	TOYOTA ; 2011
Place of Inspection:	YIBAL
Ref. Standard:	ISO22915-2 /BS EN 1459/SP2275
Registration No. & Owner No.:	701 YS ; PLM-1526
Model No. and Serial No.:	62-8FD30 ; 608FD135-35326
Running hours:	4241.2 hrs.
Manufacturer's documentation:	Satisfactory
Date of Previous inspection / cert no:	13/11/2018 ; O/38758/18/11/08
Date of Next inspection:	04/11/2019
Date of Previous load test / cert no:	16/06/2016 ; 7166LTC-001
Date of Next load test:	15/06/2020
Availability of operations manual in cabin:	Satisfactory
Availability of daily check report:	Satisfactory

Description of Forklift:

Diesel powered hydraulic counter balanced fork lift with side shifter SWL : 3000 kgs @ 500mm load center,

Test carried out according to tabulated column		
Description of test:	Test load applied In kgs	S.W.L In kgs
Visual inspection, Functional test & Performance test carried out.	3000 kg	3000 kg
Max. Lifting Height: 4300mm		
Hydraulic creep : Nil		

Conclusion: Fit for its intended use at the time of inspection.

Approved by, Name & Signature: Mr. Gishin Thomas

Inspected by, Name & Signature: Infanso Oswin





Annexure of certificate of test & thorough examination of Fork lift

Certificate no: O/40328/19/05/01

Inspection date: 05/05/2019

Description	Condition	Remarks
Tires, rims, wheel bolts and axles	Satisfactory	
Masts and Back rest , carriage	Satisfactory	
Forks and its extensions, slide end stopper, locks	Satisfactory	
Load chain and its assemblies	Satisfactory	
Side rollers and roll over cage	Satisfactory	
Safety devices	N/A	
Battery and its connections	Satisfactory	
Hydraulic system & hoses and end fittings	Satisfactory	
Electrical system & Cables	Satisfactory	
Cooling system	Satisfactory	
Steering function	Satisfactory	
All controls levers function & symbols legible.	Satisfactory	
Capacity plate in place and legible	Satisfactory	
All gauges in cab	Satisfactory	
Over head & foot guard	Satisfactory	
Exhaust system	Satisfactory	
Side shifting function (if applicable)	Satisfactory	
Horn, reverse alarm, rotating warning light	Satisfactory	
Lights & indicators	Satisfactory	
Seat and seat belts	Satisfactory	
Parking brake and foot brake function	Satisfactory	
Fire extinguisher	Satisfactory	
MPI fork blades, date / report nr. (annually)	Satisfactory	13/11/2018 ; O/38758/18/11/09
Mast disassembly (every 4 years)	N/A	
General condition	Satisfactory	
Display markings (SWL, tire pressure, insp. date, due date)	Satisfactory	
Details of tools/equipments used: Vernier Caliper (STS-VC-7949) ; Measuring tape (STS-LD-63).		

General comments: NONE

Approved by, Name & Signature: Mr. Gishin Thomas



Inspected by, Name & Signature: Infanso Oswin

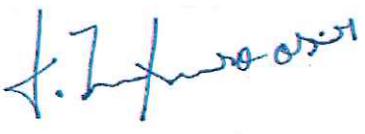


الشركة الفنية لخدمات السلامة ش.م.م
SAFETY *technical* SERVICES CO. LTD.



MAGNETIC PARTICLE INSPECTION REPORT

Date of Thorough Examination: 13/11/2018	Report number: O/38758/18/11/09	Job no: 38758
Name and Address of owner for whom the thorough examination was made: PREMIER LOGISTICS MUSCAT SULTANATE OF OMAN		Address of premises at which the examination was made: JIFFNAIN
Method: WET Surface Condition: Acceptable	Material: Carbon Steel Equipment: Permanent magnet Yoke	Test temperature: Ambient
Area Inspected (tick the appropriate box): <input checked="" type="checkbox"/> Weldment areas <input checked="" type="checkbox"/> Stress Areas <input type="checkbox"/> Full Body <input type="checkbox"/> Others		
WHITE CONTRAST PAINT: Magnavis WCP	MAGNETISING METHOD: Wet suspension black ink	
BLACK MAGNETIC INK: Magnaflux 7HF	ACCEPTANCE CODE: ASME V ARTICLE 7 , ASTM E709 ,AWS D1.1	
Description and identification of the equipment: <u>TEST CARRIED OUT ON FORK HEEL, TOE & UPPER, LOWER HOOKS.</u>		
Make : TOYOTA		
Model no. : 62-8FD30		
Serial no. : 608FDJ35-35326		
Owner Fleet No. : PLM-1526		
Reg. No. : 701 YS		
Fork ID No. : F1 & F2		
Qty: 1 pair		
Date of Last MPI/ Cert No(If any): 09/11/2017 ; A/35429/17/11/03		
Result of the above test :		
MPI TEST CARRIED OUT SATISFACTORILY, FOUND NO RELEVANT INDICATIONSAT THE TIME OF INSPECTION		

Inspected by, Name & Signature : Qualification : ASNT L2	Infanso Oswin 	Latest date by which next MPI must be carried out: 12/11/2019
Name and address of employer of persons making and authenticating this report: SAFETY TECHNICAL SERVICES PO BOX 3288. SEEB. PC 111 MUSCAT. lifting@safetyoman.com		