


MAGNETIC PARTICLE INSPECTION REPORT

Date of Thorough Examination: 27/04/2023	Report number: K/51150/23/04/06	Job no: 50547
Name and Address of owner for whom the thorough examination was made: TRUCK OMAN EQUIPMENT RENTAL SULTANATE OF OMAN		Address of premises at which the examination was made: ADAM
Method: WET Surface Condition: Acceptable	Material: Carbon Steel Equipment: Permanent magnet Yoke	Test temperature: Ambient
Area Inspected (tick the appropriate box): <input checked="" type="checkbox"/> Weldment areas <input checked="" type="checkbox"/> Stress Areas <input type="checkbox"/> Full Body <input type="checkbox"/> Others		
WHITE CONTRAST PAINT: Magnavis WCP	MAGNETISING METHOD: Wet suspension black ink	
BLACK MAGNETIC INK: Magnaflux 7HF	ACCEPTANCE CODE: ASME V ARTICLE 7 , ASTM E709 ,AWS D1.1	
Description and identification of the equipment: Fork Heel & WELDS Make: CAT REG NO : 1002 YD OWNER ID : TER 1522 SERIAL NO : 2631010-11CC/43/20(PAIR)		
Qty: 1 PAIR Date of Last MPI/ Cert No(If any):N/A		
Result of the above test : MPI TEST CARRIED OUT SATISFACTORILY, FOUND NO RELEVANT INDICATIONSAT THE TIME OF INSPECTION		
Inspected by, Name & Signature : Koshy Mathew		Latest date by which next MPI must be carried out: After One Year as Per Client Requirement Or At The Discretion Of Lifting Inspector
Qualification : ASNT L2		
Name and address of employer of persons making and authenticating this report: Address: SAFETY TECHNICAL SERVICES AND INSPECTIONS P.O. Box 3288. Airport Heights PC 111 Sultanate of Oman. lifting@safetyoman.com		

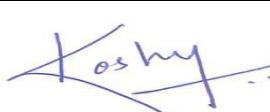