



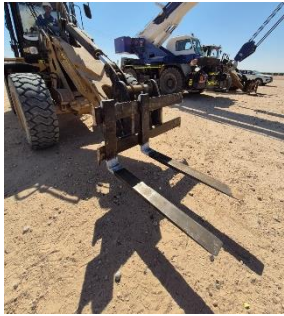
الشركة الفنية لخدمات السلامة والفحص الفني ش.م.م

SAFETY TECHNICAL SERVICES AND INSPECTIONS

Tel : +968 24502589, Fax : +968 24590272. Email: stsi@safetyoman.com, Website: www.safetyoman.com
P.O. Box 3288, Airport Heights P.C. 111, Sultanate of Oman.



MAGNETIC PARTICLE INSPECTION REPORT

Date of Thorough Examination: 19/11/2025	Report number: GE/5096/25/11/02	Job no: 5096
Name and Address of the Owner of the Equipment TRUCKOMAN EQUIPMENT RENTAL LLC. SULTANATE OF OMAN	Address of premises at which the examination was made: CCED FARAH SITE	
Method: WET Surface Condition: Acceptable	Material: Carbon Steel Equipment: Permanent magnet Yoke	Test temperature: Ambient
Area Inspected (tick the appropriate box): ☒ Weldment areas ☒ Stress Areas ☐ Full Body ☐ Others		
WHITE CONTRAST PAINT: Magnaflux WCP	MAGNETISING METHOD: Wet suspension black ink	
BLACK MAGNETIC INK: Magnaflux 7HF	ACCEPTANCE CODE: ASME V ARTICLE 7 , ASTM E709 ,AWS D1.1	
Description and identification of the equipment: CATERPILLAR WHEEL LOADER FORK ATTACHMENT Tines Length: 1170 mm Serial No.: TUC813C133 Fitted in Crane Reg. No.: 2516 YS (TER 1527) Date of Last MPI/ Cert No. (If any): 06/12/2024 (MN/2414/24/12/02)		
Result of the above test : MPI TEST CARRIED OUT SATISFACTORILY, FOUND NO RELEVANT INDICATIONS AT THE TIME OF INSPECTION		
Inspected by, Name & Signature : GERARD D. ENRIQUEZ Qualification: ASNT LEVEL 2		Latest date by which next MPI must be carried out: AFTER ONE YEAR AND OR AT THE DISCRETION OF THE LIFTING INSPECTOR
Name and address of employer of persons making and authenticating this report: Address: SAFETY TECHNICAL SERVICES AND INSPECTIONS P.O. Box 3288. Airport Heights PC 111 Sultanate of Oman. lifting@safetyoman.com		