


MAGNETIC PARTICLE INSPECTION REPORT

Date of Thorough Examination: 23/11/2022	Report number: MP/49823/22/11/11	Job no: 49823
Name and Address of owner for whom the thorough examination was made: TRUCK OMAN (SOUTH) SULTANATE OF OMAN		Address of premises at which the examination was made: SAFAH
Method: WET Surface Condition: Acceptable	Material: Carbon Steel Equipment: Permanent magnet Yoke	Test temperature: Ambient
Area Inspected (tick the appropriate box): <input checked="" type="checkbox"/> Weldment areas <input type="checkbox"/> Stress Areas <input type="checkbox"/> Full Body <input type="checkbox"/> Others		
WHITE CONTRAST PAINT: Magnavis WCP	MAGNETISING METHOD: Wet suspension black ink	
BLACK MAGNETIC INK: Magnaflux 7HF	ACCEPTANCE CODE: ASME V ARTICLE 7 , ASTM E709 ,AWS D1.1	
Description and identification of the equipment: <u>UPPER HOOKS, LOWER HOOK, HEEL & TOE</u>		
Owner ID No. : TO-2536 Reg. no. : 6601 HM Fork Serial No. : 2001750-L1 & 2001754-L1		
Qty: 1no Date of Last MPI/ Cert No(If any): 24/11/2021; MA/47955/21/11/09		
Result of the above test : MPI TEST CARRIED OUT SATISFACTORILY, FOUND NO RELEVANT INDICATIONS AT THE TIME OF INSPECTION		
Inspected by, Name & Signature : Koshy Mathew Qualification : ASNT L2		Latest date by which next MPI must be carried out: 22/11/2023
Name and address of employer of persons making and authenticating this report: Address: SAFETY TECHNICAL SERVICES AND INSPECTIONS P.O. Box 3288, Airport Heights PC 111 Sultanate of Oman. lifting@safetyoman.com		

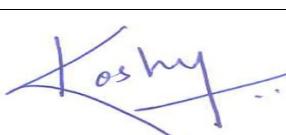