

TÜV SÜD MIDDLE EAST LLC

Head Office: P.O Box: 45117, Abu Dhabi - U.A.E

Tel.: +971 2 6767 600 | Fax: +971 2 6762 224

Email: ad.report@tuvsgdme.com

Branch Office: P.O Box: 1621,
Al Azaiba, P. C. 130

Tel.: +968 2449 3451 | Fax: +968 2449 3603

Email: info.o@tuvsgdme.com

Website: www.tuv-sud.ae

TÜV®



Middle East

توف سود ميدل ايست ذ.م.م

صندوق البريد: ٢٨٣٤ - دبى - ا.م.ز.

هاتف: +٩٧١٤٤٤٧٣١١٢ | فاكس: +٩٧١٤٤٤٧٣١١٢

ص.ب: ١٦٢١ العنوان: الرمز البريدي: ١٣٠

مسقط، سلطنة عمان

هاتف: +٩٦٨٢٤٤٩٣٤٥١ | فاكس: +٩٦٨٢٤٤٩٣٤٥١

Certificate No.:

MU-AS-18-2668/2861/1-SP

TIMESHEETS: 1013610

R1

CERTIFICATE OF TEST & THOROUGH EXAMINATION OF LORRY LOADER CRANE

Date of Report: 22/10/2018

Date of Thorough Examination: 22/10/2018

Name and Address of the Owner:	Truckoman Equipment Rental LLC P.O. Box: 367 P.C: 116, SULTANATE OF OMAN		
Maker & Date of Manufacture:	PM GROUP, ITALY/2018		
Place of Thorough Examination :	GHALA		
Ref. Standard:	BS 7121-2-4:2013		
Registration No. & Owner No.:	9888 MB		
Model and Serial No.:	Model : PM 27.5PX Serial No.: G14601751823		
Nr. of running hours and/or km read out	BRAND NEW		
Manufacturer's documentation:	Available		
Date of Previous Thorough Examination / cert. no:	BRAND NEW		
Date of Next Thorough Examination :	21/10/2019		
Date of Previous load test / cert. no:	BRAND NEW		
Date of Next load test:	21/10/2022		
Availability of operations manual in cab:	Available		
Load Chart in cab:	Available on boom and near control levers		
Accessories certificates:	Not Available		
Availability of daily check report:	Available		

Description of boom truck:

Truck mounted diesel hydraulic lorry loader Crane with Articulated, telescopic Boom. Boom length 2.20 mtr to 10.25 mtr, Maximum capacity of boom truck 10840 kg at 2.20 mtr boom length,

Description of test: Thorough examination & 110% SWL Load carried out Hook capacity 12 t. Test carried out according to tabulated column. Load cell: S. N.: BNG085 Certificate No.: C180695927 Date: 26/06/2019	Radius Mtr	Test load kg	Safe working load kg
	2.20	11924	10840
	6.15	4207.5	3825
	10.25	2480.5	2255

Conclusion: Test and Thorough Examination carried-out and was found Satisfactory at the Time of Examination

Authorized by:
SREENATH POKKADAVATH
Technical Manager

Inspected and report prepared by:
ALI WAKAF
Inspection Engineer


THIS IS TO CERTIFY THAT the above signed competent surveyor thoroughly examined and tested the lifting equipment in the above-mentioned place as per Ref. Standard. The liabilities and insurance is as per TUV SUD Middle East, L.L.C. General Conditions of Services.

Time sheet No: 1013610

S.t:11433

1/2

QF/OM-LLC-03 Rev.02

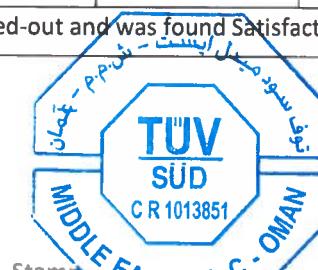

ANNEXURE OF CERTIFICATE OF TEST & THOROUGH EXAMINATION OF LORRY LOADER CRANE

DESCRIPTION	CONDITION	REMARKS
Safe load indicator/calibration verified	N/A	
Level indicator / Angle indicator	N/A	
Telescope boom extensions/ Boom pads/ Rope guides	Satisfactory	
Lattice boom sections/Connecting pins/Boom back stops	N/A	
Mast and its attachments	N/A	
Pendant ropes	N/A	
Fly Jib / Luffing jib/ Derricking interlock security	N/A	
Main hoist winch/ Hoist drum / Correct spooling	N/A	
Main hoist wire ropes and termination	N/A	
Auxiliary hoist winch/ Hoist drum / Correct spooling	N/A	
Auxiliary wire ropes and termination	N/A	
Counterweight and its locking mechanism	N/A	
Access ladders/Walkways/Hand & guard rails	Satisfactory	
Outriggers / Pads	Satisfactory	
Tyres & wheels	Satisfactory	
Crawler Tracks/Track shoe	N/A	
Swing machinery / Swing alarm/Clearance	Satisfactory	
Turntable bearing	Satisfactory	
Hook block system/Safety catch	Satisfactory	
Hook MPI certificate no (Required every 4 yrs)	N/A	
Sheaves (Boom & Shackle)	N/A	
Operator cab/ Control levers /Wind shields / Mirrors	Satisfactory	
Anti 2 block /over lower/ boom cut off /over load cut off limit switches / Slack rope limiter(if fitted)	N/A	
Proximity switches	N/A	
All fasteners /Bolts / Safety pins	Satisfactory	
Electrical System	Satisfactory	
Hydraulic System	Satisfactory	
Caution rotary light	Satisfactory	
Reverse Horn / Light	Satisfactory	
Fire extinguisher	Satisfactory	
Anemometer(if fitted or hand held)	N/A	
General condition	Satisfactory	

General comments:

- Only Certified Trained Operator Allowed to Operate the Equipment.
- This certificate covers only the existing configuration of the equipment at the time of examination. Any changes, alteration or modification shall require re-inspection or re-testing

Authorized by:


SREENATH POKKADAVATH

Technical Manager



Inspected and report prepared by:

ALI WAKAF
Inspection Engineer

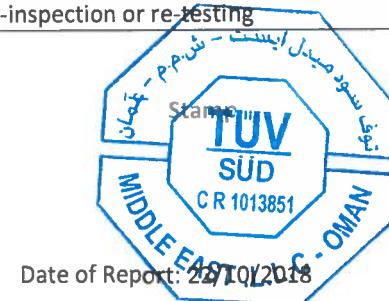Date of Report: 22/10/2018

The certificate is issued subject to the condition that it is understood and agreed that nothing in this report shall be deemed to relieve any designer, manufacturer, seller, supplier, repairer or operator of any warranty, expressed or implied, and TÜV SÜD Middle East, LLC shall be limited to the acts or omissions of its employees, agents and subcontractors. Under no circumstances whatsoever shall TÜV SÜD Middle East, LLC be liable for any injury or damage to any person, or occurring by reason of negligent operation or any defect in materials, machinery, equipment or other items other than such defects ascertainable by normally accepted testing standards and only those items inspected by TÜV SÜD Middle East, LLC and which are covered by this certificate.