


MAGNETIC PARTICLE INSPECTION REPORT

Date of Thorough Examination: 28/12/2022	Report number: A/50805/22/12/50	Job no: 50805
Name and Address of owner for whom the thorough examination was made: TRUCK OMAN EQUIPMENT RENTAL SULTANATE OF OMAN		Address of premises at which the examination was made: FARAH
Method: WET Surface Condition: Acceptable	Material: Carbon Steel Equipment: Permanent magnet Yoke	Test temperature: Ambient
Area Inspected (tick the appropriate box): <input type="checkbox"/> Weldment areas <input type="checkbox"/> Stress Areas <input type="checkbox"/> Full Body <input checked="" type="checkbox"/> Others [Top Surface]		
WHITE CONTRAST PAINT: Magnavis WCP	MAGNETISING METHOD: Wet suspension black ink	
BLACK MAGNETIC INK: Magnaflux 7HF	ACCEPTANCE CODE: ASME V ARTICLE 7 , ASTM E709 ,AWS D1.1	
Description and identification of the equipment: <u>FIFTH WHEEL</u>		
Make: JOST		
Serial No.: 133333150-63		
Reg. No.: 3009 RK		
Fleet No: TER 1059		
Qty: 1nos		
Date of Last MPI/ Cert No(If any): 09/01/2022; K/48159/22/01/05		
Result of the above test: MPI TEST CARRIED OUT SATISFACTORILY, FOUND NO RELEVANT INDICATIONS AT THE TIME OF INSPECTION		

Inspected by, Name & Signature: Koshy Mathew		Latest date by which next MPI must be carried out: 27/12/2023
Qualification: ASNT L2		
Name and address of employer of persons making and authenticating this report: Address: SAFETY TECHNICAL SERVICES AND INSPECTIONS P.O. Box 3288. Airport Heights PC 111 Sultanate of Oman. lifting@safetyoman.com		

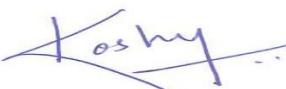