


MAGNETIC PARTICLE INSPECTION REPORT

Date of Inspection: 06/09/2020	Report number: O/44490/20/09/29	Job no: 44490
Name and Address of the Owner of the Equipment TRUCK OMAN NORTH SULTANATE OF OMAN		Address of premises at which the examination was made: ADAM
Method: WET Surface Condition: Acceptable	Material: Carbon Steel Equipment: Permanent magnet Yoke	Test temperature: Ambient
Area Inspected (tick the appropriate box): <input checked="" type="checkbox"/> Weldment areas <input checked="" type="checkbox"/> Stress Areas <input type="checkbox"/> Full Body <input type="checkbox"/> Others		
WHITE CONTRAST PAINT: Magnavis WCP	MAGNETISING METHOD: Wet suspension black ink	
BLACK MAGNETIC INK: Magnaflux 7HF	ACCEPTANCE CODE: ASME V ARTICLE 7 , ASTM E709 ,AWS D1.1	
Description and identification of the equipment: <u>Fork Heel , Upper & Lower Hooks</u>		
Make: Caterpillar		
Reg no: 5142 WK		
Owner id no: TO 2526		
Fork Serial no: 371 2376 371 2377		
Qty: 1 no		
Date of Last MPI/ Cert No(If any): 04/09/2019; MP/40940/19/09/38		
Result of the above test :		
MPI TEST CARRIED OUT SATISFACTORILY, FOUND NO RELEVANT INDICATIONS AT THE TIME OF INSPECTION		

Inspected by, Name & Signature : Koshy Mathew		Latest date by which next MPI must be carried out: 05/09/2021
Qualification : ASNT L2		
Name and address of employer of persons making and authenticating this report: Address: SAFETY TECHNICAL SERVICES AND INSPECTIONS P.O. Box 3288. Airport Heights PC 111 Sultanate of Oman. lifting@safetyoman.com		

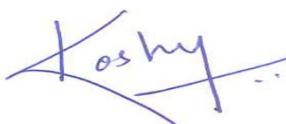